

General Specifications

Motor Type: DC Brushless Motor

Motor Protection: Auto Restart/Polarity Protection (Motor withstands reverse connection for positive and negative leads.)

Insulation Resistance: 10M Ω or over with a DC500V Megger

Dielectric Withstand Voltage: AC 700V 1sec or AC 500V 1min


Allowable Ambient Temperature Range:

-10°C ~ +70°C (Operating)

-40°C ~ +70°C (Storage)

(non-condensing environment)

Characteristics Curve

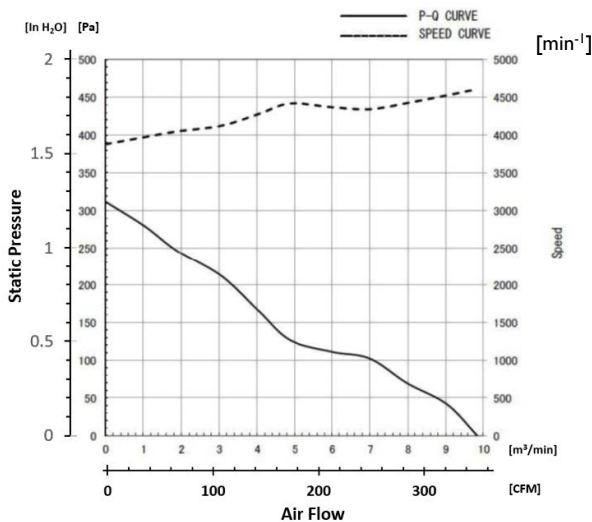

IP Rated Fan Benefits & Applications

IP68/69K

NMB offers Ingress Protection (IP) rated cooling fans. IP68 fans provide dust tight protection, and safeguard against wet location and powerful water jets for outdoor applications and other harsh environments. NMB fans are designed with NMB precision machined ball bearings assuring long life and high reliability.

Benefits

- IP68 rating per IEC 60529 standard
- Long life and high reliability with NMB stainless precision ball bearings with 100K hr at 25C (L10)
- Open Collector Tacho Signal output for fan speed
- PWM Speed Control

Applications

- Outdoor Applications
- Factory Automation
- Food Processing
- Inverters
- Telecomm
- Horticulture

Life Expectancy L10

25°C 100,000 Hours

Specifications


MODEL	Rated Voltage	Operating Voltage	Current		Input Power		Speed	Max. Air Flow ^{*2}		Max. Static Pressure ^{*2}		Noise	Mass
			Avg	Max	Avg	Max		(CFM)	(m³/h)	(in H ₂ O)	(Pa)		
17250VG-48R-GU-01	(V)	(V)	(A) ^{*1}	(A) ^{*1}	(W) ^{*1}	(W) ^{*1}	(min ⁻¹) ^{*1}					(dB) ^{*1}	(g)
	48	38.0 ~ 52.8	0.90	1.10	43.20	52.80	4,600	346.08	9.80	1.25	312	62.0	950

*1: Values in Free Air

*2: Attach Inlet-ring (NMB: IR12714)

PWM Specifications


Connection wiring diagram

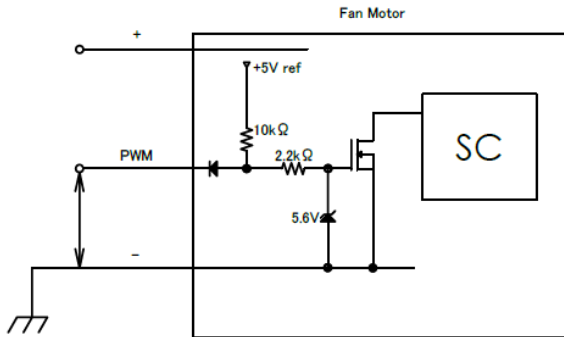

1. PWM Control

- | | |
|--|-----------------------------|
| V _{st} = Low Level (0V~0.4V) | → Stop (On Duty 0%) |
| V _{st} = High Level (4.0V~5.0V) | → Full Speed (On Duty 100%) |
| V _{st} = Open | → Full Speed |

2. PWM Duty & PWM Input Pulse

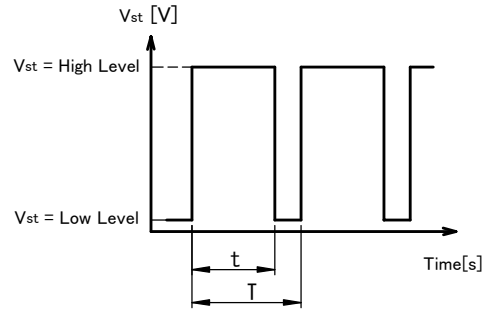

PWM Duty means that a ration of high level time (t)/PWM Input Pulse(T).

$$(t/T) \times 100 : \text{On Duty } 0\% \sim 100\%$$

$$\text{PWM Frequency } f = 25[\text{kHz}]$$


3. The condition for PWM control are as follows.

- When you use this under PWM control, always be sure the motor's operation under practical mounting state. Fan motor may not start up caused by PWM control at very low speed condition.
- To run at Rating Voltage.
- Please use the start with Duty 30% or more at 25kHz. [At rated voltage input, Ambient temperature 25°C]

PWM Characteristic Curve

Reference PWM Duty VS Speed

Conditions: at rating Voltage, V_{st}=5.0V, f=25kHz, T_a=25°C

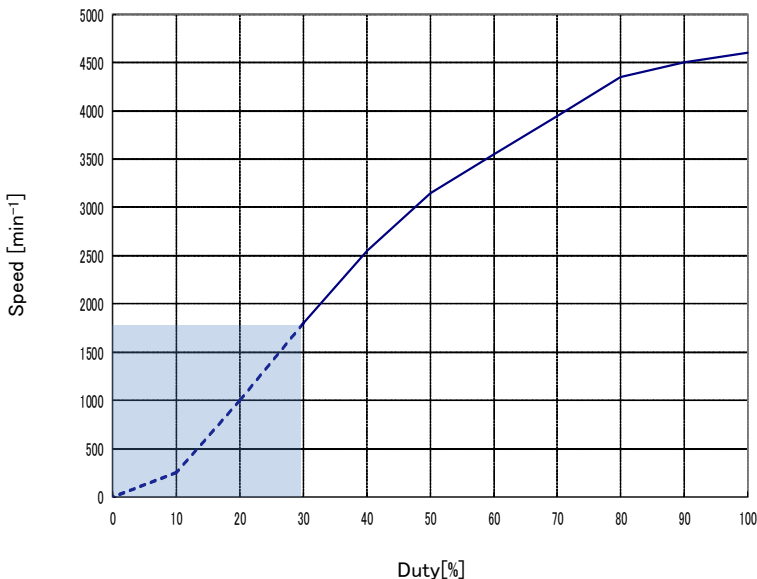

TACHO Specifications


TACHO SIGNAL

1. OUTPUT CIRCUIT : OPEN COLLECTOR
2. SPECIFICATION

Absolute Maximum Ratings at Ta=25°C

V_{CE} max : +52.8V


I_c max : 5mA [V_{CE(sat)}max = 2V]

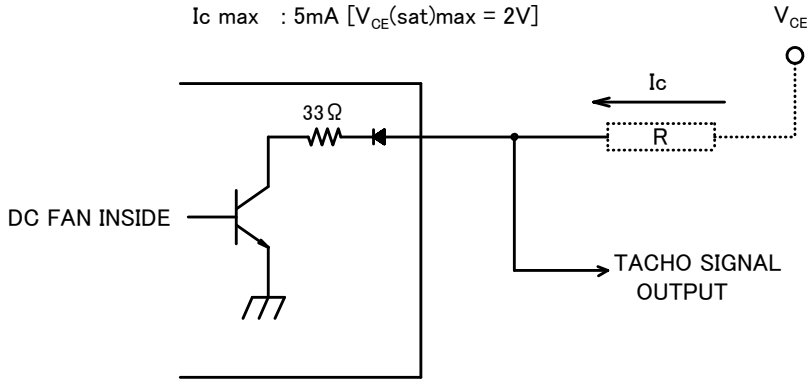


TACHO SIGNAL CIRCUIT

OUTPUT WAVEFORM : (AT RATED OUTPUT SIGNAL VOLTAGE)

Case-1

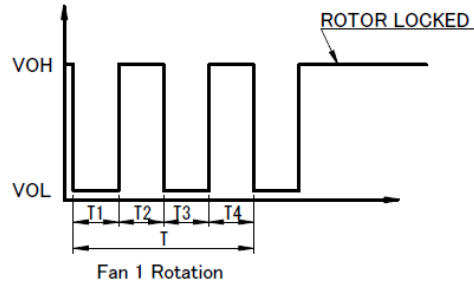


Case-2

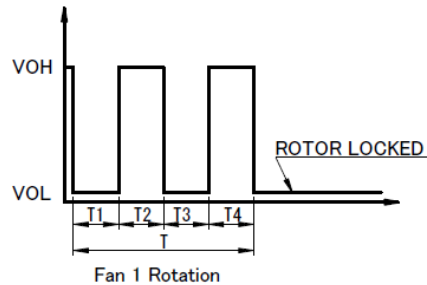

- 1) When the rotor is locked at VOH position of signal, signal keeps VOH position.
- 2) When the rotor is locked at VOL position of signal, signal keeps VOL position.
- 3) $T = T1 + T2 + T3 + T4 = 60 / m = 1 \text{ rotation}$
 m : fan rotational speed (min^{-1})
 Tach Duty Cycle = $50\% \pm 10\%$

Panel Cutouts

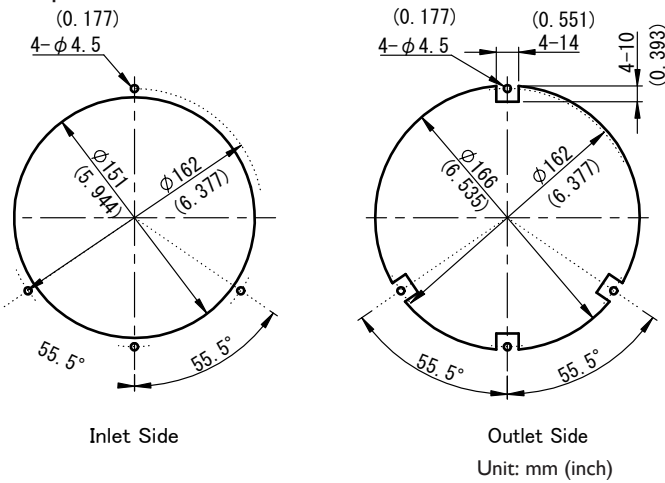

Material

- Casing : Aluminum (Paint Black)
- Impeller : Plastic
- Bearing : Ball Bearing
- Lead Wire : UL3443 AWG22 or equivalent
(+): Red (-): Black
- (PWM): Brown (Tacho): White

Outline

